

WATERPROOF DIGITAL INDICATORS


WATERPROOF

DATA
OUTPUT

INSPECTION
CERTIFICATE




2115-10

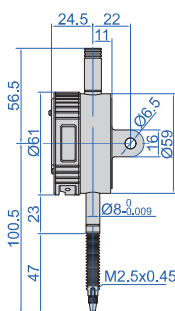

2115-10
2115-101




2115-25

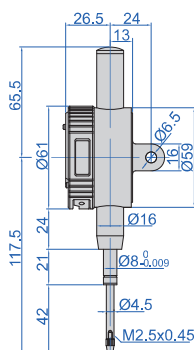

2115-25
2115-251



2115-50

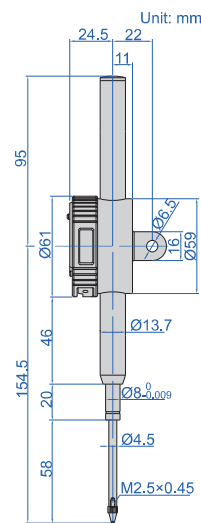


2115-50
2115-501

- Dust/waterproof
- Button function: on/off, zero, mm/inch, data preset, tolerance, change measuring direction, max./min./TIR measurement, absolute/incremental measurement
- Keep preset data and tolerance data in memory after restart
- CR2032 battery, automatic power off
- Data output
- Optional accessory:
wireless transmitter code **7315-50M** (receiver is needed),
data output cable code **7302-40M**, **7305-40M**,
backs, contact points

spindle lift knob is
included (except
2115-101/101F,
2115-10/10F)



max./min./TIR

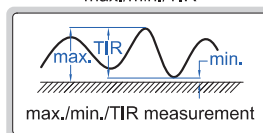

alarm when over tolerance



Resolution 0.001mm/0.00005"

Code	Range	Dust/waterproof	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2115-101 *	12.7mm/0.5"	IP65	5µm	2µm	1.5N	cannot lift	lug back
2115-251 *	25.4mm/1"	IP54	5µm	3µm	2.2N	cannot lift	lug back
2115-501 *	50.8mm/2"	IP54	6µm	3µm	2.5N	cannot lift	lug back
2115-101F *	12.7mm/0.5"	IP65	5µm	2µm	1.5N	cannot lift	flat back
2115-251F *	25.4mm/1"	IP54	5µm	3µm	2.2N	cannot lift	flat back
2115-501F *	50.8mm/2"	IP54	6µm	3µm	2.5N	cannot lift	flat back

Resolution 0.01mm/0.0005"

Code	Range	Dust/waterproof	Accuracy	Hysteresis	Maximum measuring force	Cap	Remark
2115-10 *	12.7mm/0.5"	IP65	20µm	10µm	1.5N	cannot lift	lug back
2115-25 *	25.4mm/1"	IP54	20µm	10µm	2.2N	cannot lift	lug back
2115-50 *	50.8mm/2"	IP54	30µm	10µm	2.5N	cannot lift	lug back
2115-10F *	12.7mm/0.5"	IP65	20µm	10µm	1.5N	cannot lift	flat back
2115-25F *	25.4mm/1"	IP54	20µm	10µm	2.2N	cannot lift	flat back
2115-50F *	50.8mm/2"	IP54	30µm	10µm	2.5N	cannot lift	flat back

*Supplied with manufacturer inspection certificate